
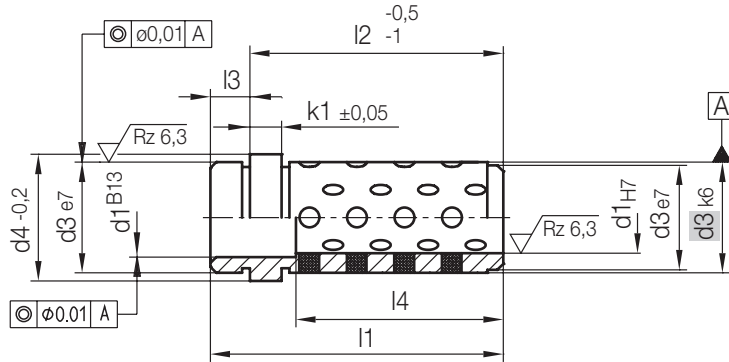


Z1000W/...

Führungsbuchse, mit Zentrieransatz, selbstschmierend
 Guide bush, stepped location head, self-lubricating
 Bague de guidage, avec plot de centrage, autolubrifiante

Mat.: 2.0975
 max.°C: 200

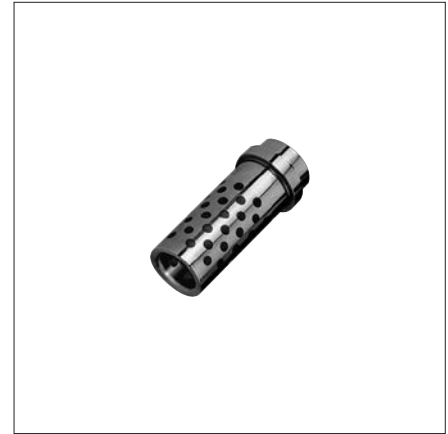



k1	l4	l3	l1	d4	d3	l2	d1	Nr./No.
3	17	5	17	16	14	12	9	Z1000W/ 12x 9
								17
								22
								27
								32
								41
								51
								61
	20	17	17	12	10	12	10	Z1000W/ 12x10
								17
								22
								27
								32
								41
								51
								61
								71
6	23	6	23	25	20	17	14	Z1000W/ 17x14
								22
								27
								32
								41
								51
								61
								71
	28	6	23	17	15	17	15	Z1000W/ 17x15
								22
								27
								32
								41
								51
								61
								71
								82
30	8	25	17	18	17	18	Z1000W/ 17x18	
							22	

k1	l4	l3	l1	d4	d3	l2	d1	Nr./No.
6	35	8	35	31	26	27	18	Z1000W/ 27x18
								36
								44
								54
								64
								74
								84
								94
	40	8	20	17	20	17	20	Z1000W/ 17x20
								22
								27
								36
								46
								56
								66
								76
								86
30	30	35	30	35	30	22	22	Z1000W/ 22x22
								27
								36
								46
								56
								66
								76
								86
	49	30	24	22	24	22	24	Z1000W/ 22x24
								27
								36
								46

Z 1000 W / ...

Führungsbuchse, mit Zentrieransatz, selbstschmierend
 Guide bush, stepped location head, self-lubricating
 Bague de guidage, avec plot de centrage, autolubrifiante

Mat.: 2.0975
 max. °C: 200

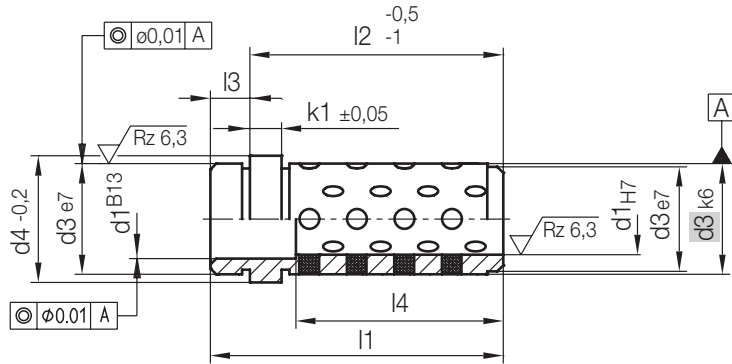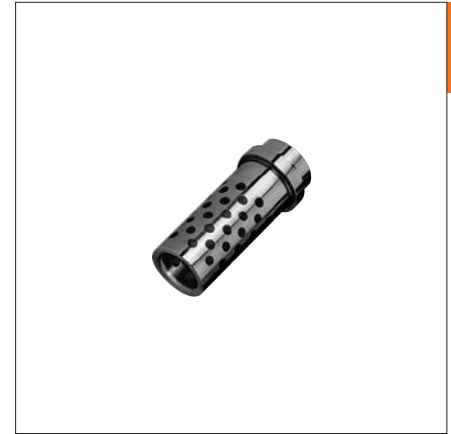

k1	l4	l3	l1	d4	d3	l2	d1	Nr./No.						
6	49	8	64	35	30	56	24	Z 1000 W/ 56x24						
						66		66						
						76		76						
						86		86						
						96		96						
						116		116						
						136		136						
						156		156						
	35	35	47	42	27	30	Z 1000 W/ 27x30							
	44	44			36		36							
	54	54			46		46							
	64	64	64	64	64	64	56		56					
							66		66					
							76		76					
							86		86					
							96		96					
116								116						
136								136						
156								156						
35	35			27	32	Z 1000 W/ 27x32								
44	44			36		36								
54	54			46		46								
64	64			56		56								
54	74			66		66								
64	84	84	84	84	84	76		76						
						86		86						
						96		96						
						116		116						
						136		136						
						156		156						
						10	46	10	46	60	54	36	40	Z 1000 W/ 36x40
						56		56		46		46		46
66		66		56		56		56						
76		76		66		66		66						
86		86		76		76		76						
76		96		86		86		86						

k1	l4	l3	l1	d4	d3	l2	d1	Nr./No.				
10	80	10	106	60	54	96	40	Z 1000 W/ 96x40				
						116		116				
						136		136				
						156		156				
						196		196				
						46	46			36	42	Z 1000 W/ 36x42
						56	56			46		46
						66	66			56		56
	76	76			66		66					
	86	86			76		76					
	80	80	80	106	80	80	96		96			
							116		116			
							136		136			
							156		156			
							196		196			
							66	66	72	66	56	50
76							76			66		66
86							86			76		76
76	96			86		86						
80	80	80	106	80	80	96		96				
						116		116				
						136		136				
						156		156				
						196		196				
						66	66			56	52	Z 1000 W/ 56x52
						76	76			66		66
						86	86			76		76
76	96			86		86						
80	106			96		96						
	126			116		116						
	146			136		136						
	166			156		156						
	206			196		196						